

0415Z 27 SEP 63

SECRET

2	5
3	6

PRIORITY

PRIORITY

IN 92942

DIRECTOR

25X1A

OPS 1-7

TOR: 1130Z 27 SEP 63

25X1A

25X1A

0074

- A. [REDACTED] 25X1A 25X1A
- B. B/10,676/[REDACTED]
- C. HTA-2/D-19/4/75
- D. 2.18/2.02
- E. 9R/8402/234-3-5-3
9L/8402/225-9-5-4-3
- F. (1) GOOD
(2) FAIR
(3) GOOD
(4) GOOD
(5) GOOD
(6) GOOD - OVERLAP FRAME 3049
(7) CLEAR

G. TAKE RECEIVED 26/0640 IN STEEL BOX. ALL TAKE REVIEWED.
WRINKLES AND TEARS CAUSED BY MALFUNCTION IN HTA-2 SQUEEZES.
WRINKLES IN FRAME NBRS. 005-016R, 028R, 045-46R, 228-231R, 1109-

SECRET

GROUP 1
Excluded from automatic
downgrading and
declassification

CRIMP 0074 (IN 92942)

PAGE TWO

1118R. TEARS IN 365-366L, 335R. STATIC MARKS 005L AND 1053-53R. MACHINE SCRATCHES 1940-43L, 1949-50L. OUT OF FOCUS FRAMES AT MODE CHANGE. MFG. SPLICES 060R, 050L, 010L. PLUS DENSITY SPOTS 1090R, 1093R, 1104R. EMULSION DEFECTS 1098, 1105, 1150, 1152, 1167, 1175, 1239, 1265, 1299, 1304, 1340-47, 1354-56, 1378, 1428, 1555, 1559, 1562-63, 3469, 3473-74, 3544-45, 3553, 3565 ALL R SIDE 2249L, 2470L. MINUS DENSITY SPOTS 005-015L, 21152R 1175R, 2015-17R, 2078R. ORIGINAL STILL BEING USED TO ACCOMPLISH DUPLICATING REQUIREMENTS.

H. HQS COURIER APPROXIMATELY 294120Z.

END OF MESSAGE

SECRET